


Evo X SST to Manual Conversion without 5MT Wire Harness Install

(SST Gearbox is removed and 5 MT installed, Lever is unplugged)

1. Shift Lock: SST Engine Starts only in P or N


Fix: Shift Lever Connector C-27 Connect Pin 5 to 7

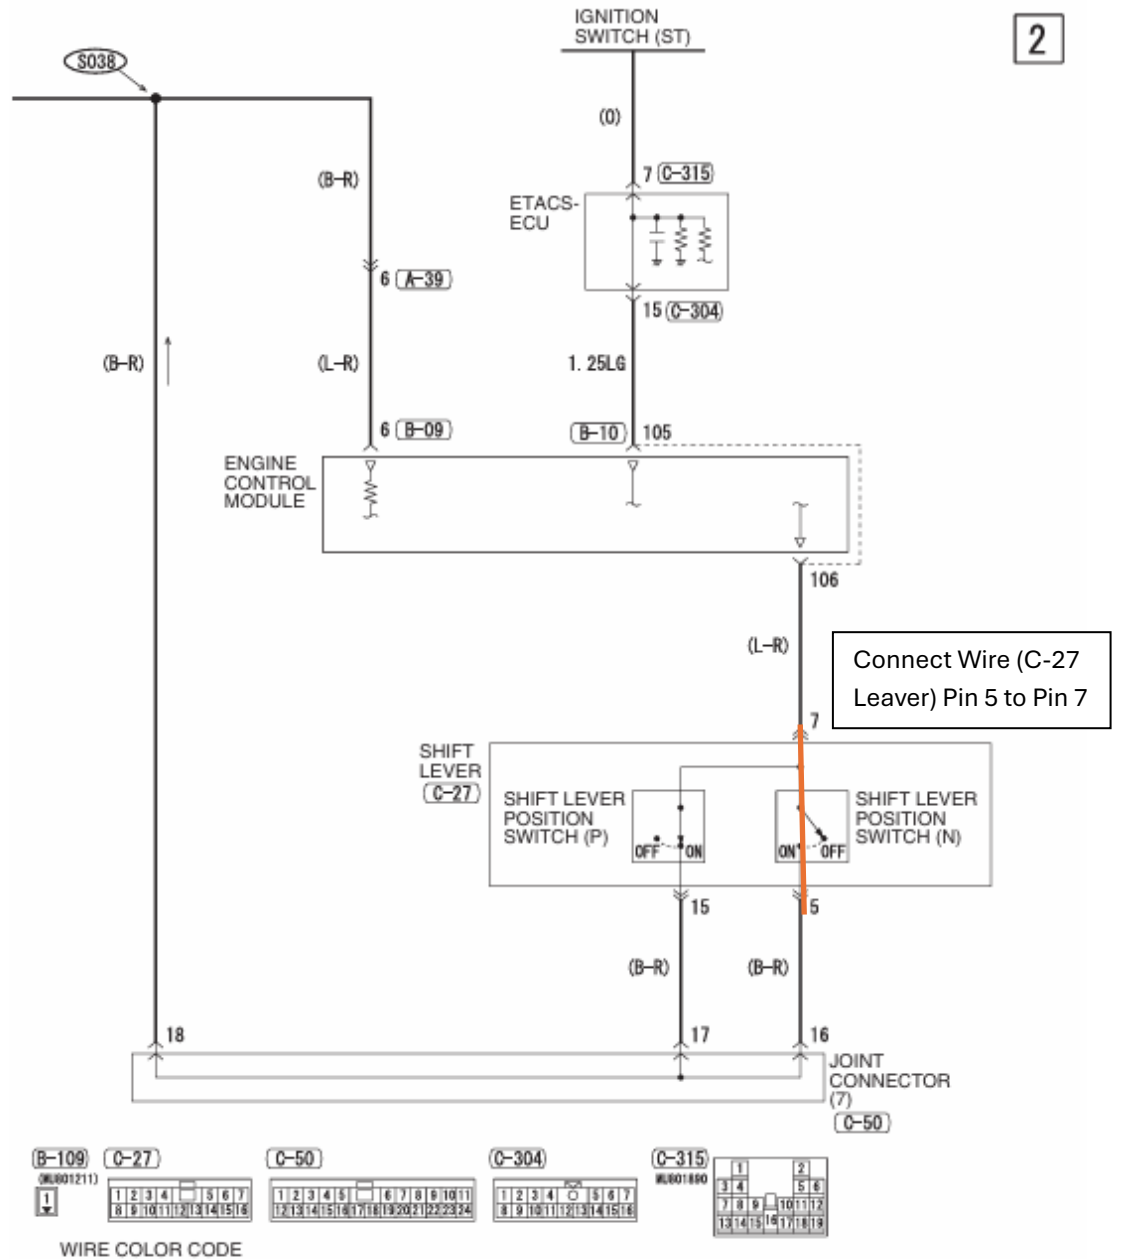


2. Backup Light: Reverse Signal come from Lever Position. The ABS Controller needs this Info.
 Fix: Shift Lever Connector C-27 Connect Pin 4 to Pin 3, Cut Wire from Pin 2 Connector C-304 at ETACS and go over Backup light Switch at the 5MT Gearbox.

BACKUP LIGHT <TC-SST>

M1901003103241

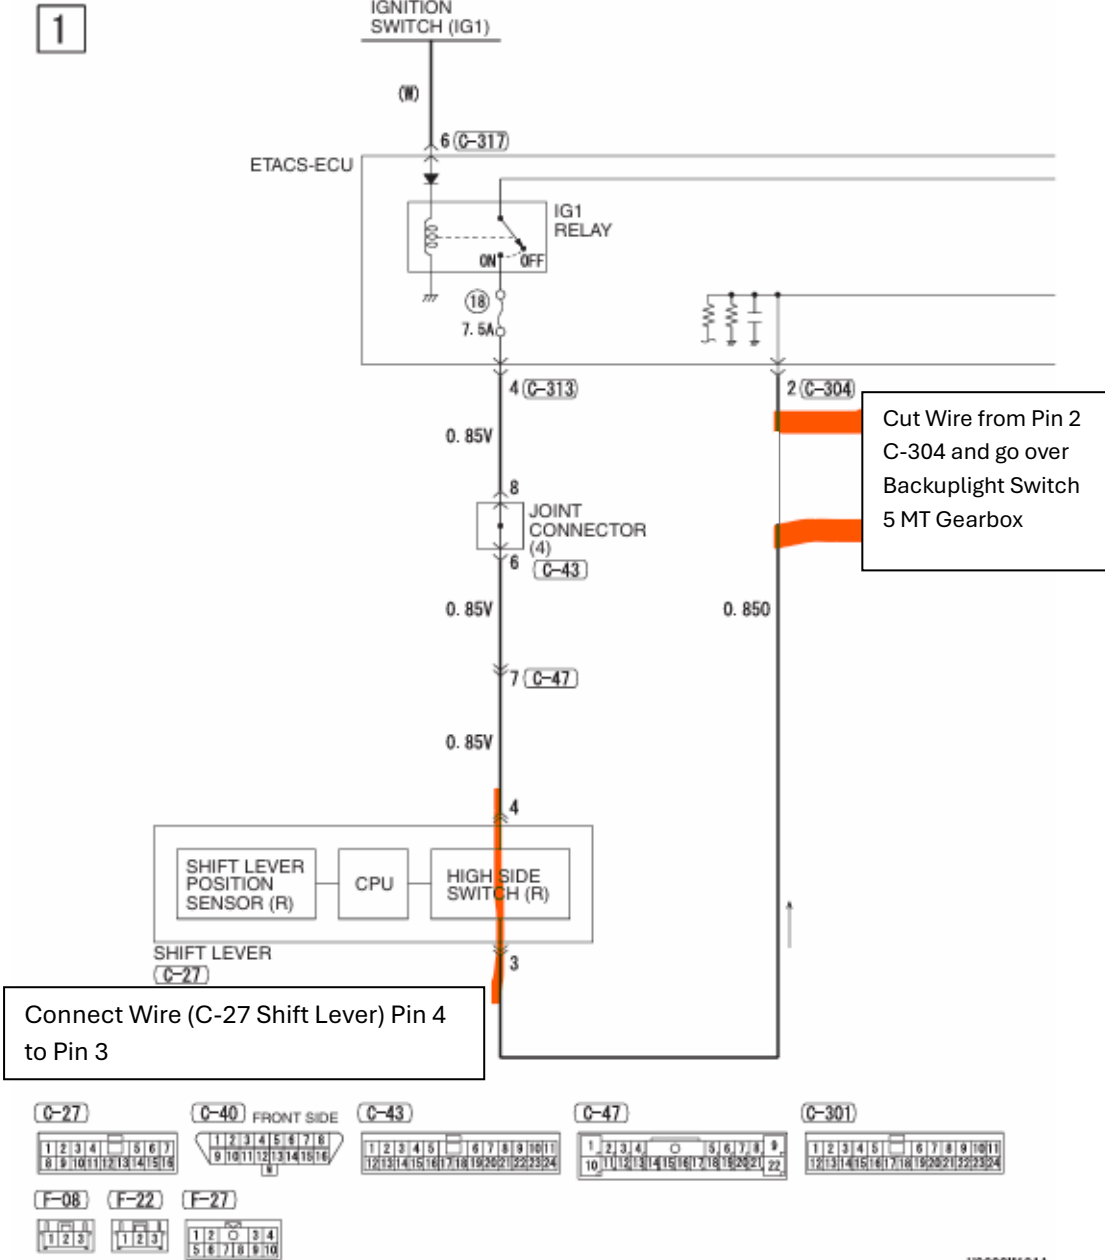

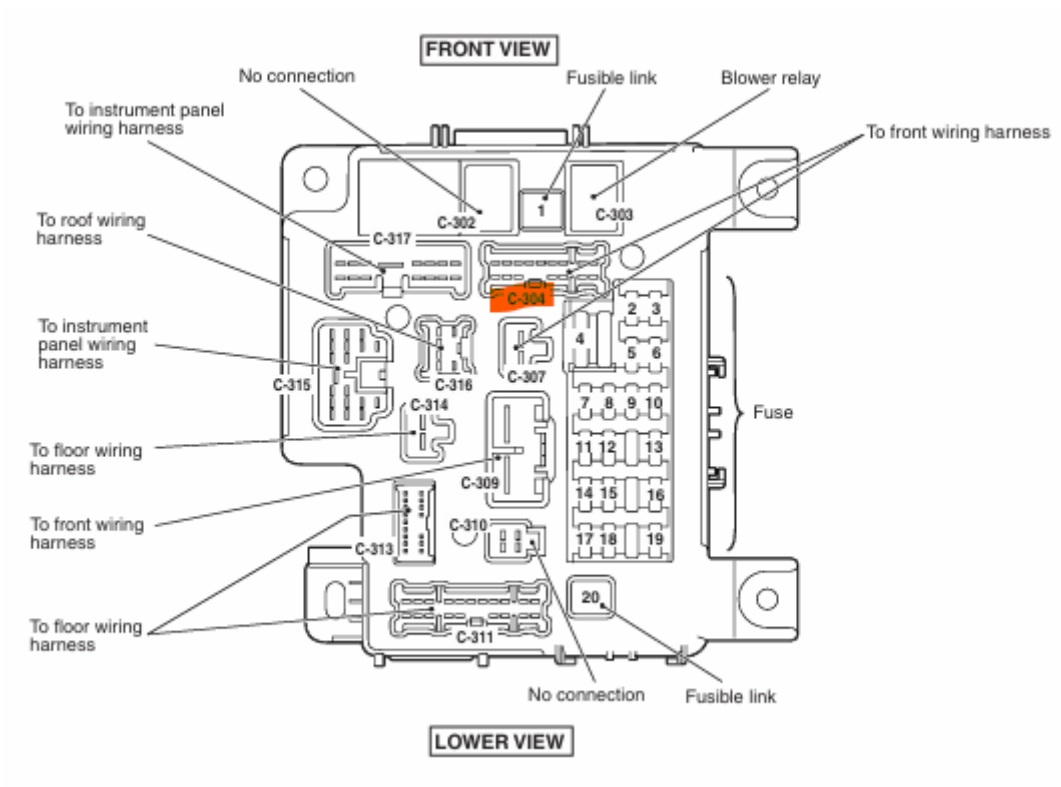

- 3: Etacs Coding: Transmission → SST to 5MT
 TCM (Transmission Control Modul) → not Present
 Lever → not Present