

GROUP 4

CORROSION
PROTECTION

CONTENTS

BODY SEALING LOCATIONS	4-2	UNDERCOAT APPLICATION LOCATIONS	4-7
ANTICORROSION PRIMER LOCATIONS	4-6		


BODY SEALING LOCATIONS

M4040001001012

If the sealant application is directly visible on the outer plate and requires appearance quality of the application in areas such as the drip rail, pillar, clinch and so on, then apply the sealant so that it is flat, or wipe off any excess mounding after the application. Be careful not to obstruct the water draining hole.


NOTE: The bold dotted line indicates the application area on the underside.

FLOOR

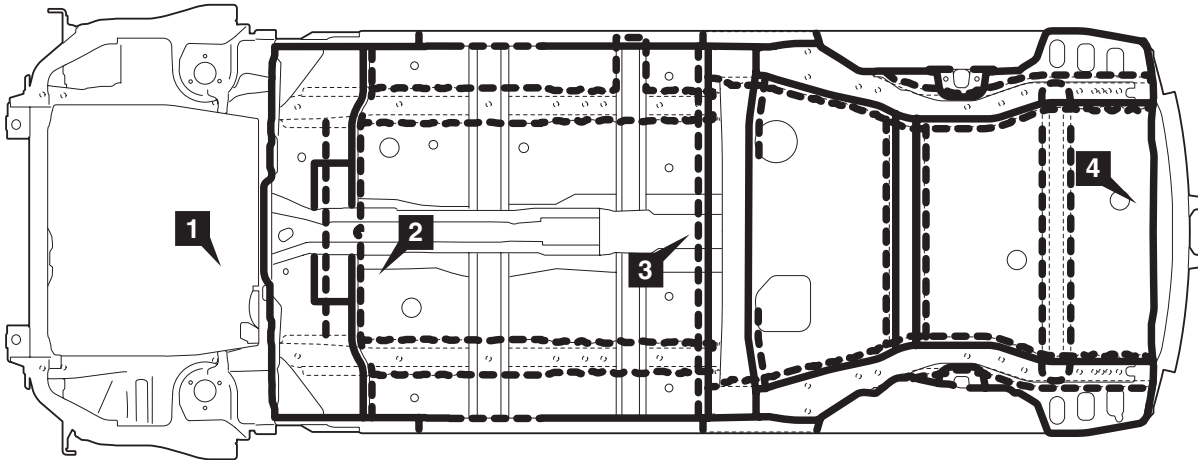






AB601210AB









UPPER BODY








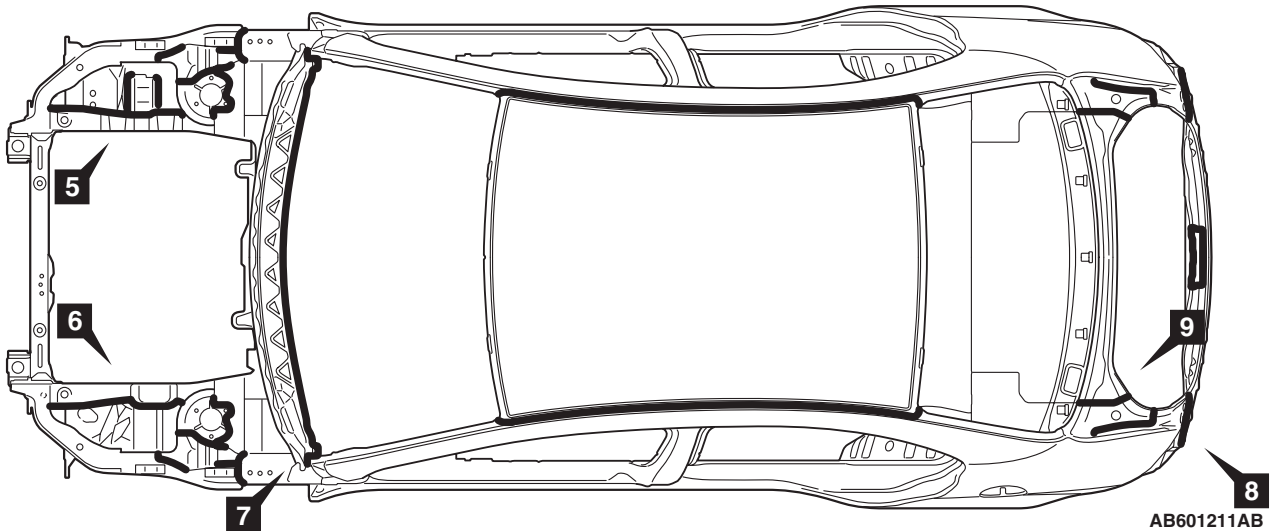


AB601211AB

SIDE BODY

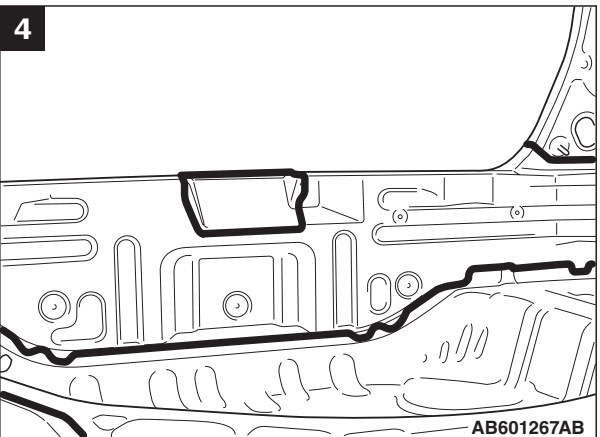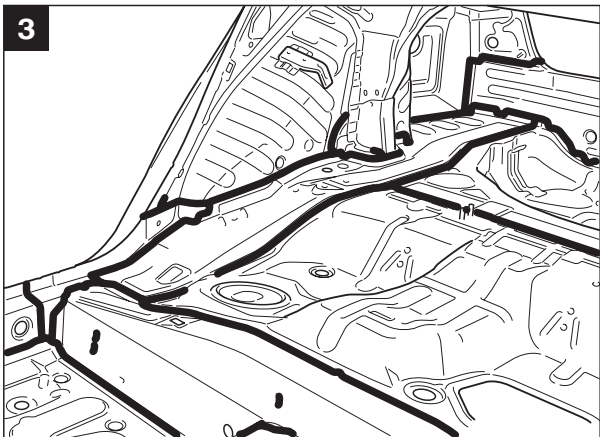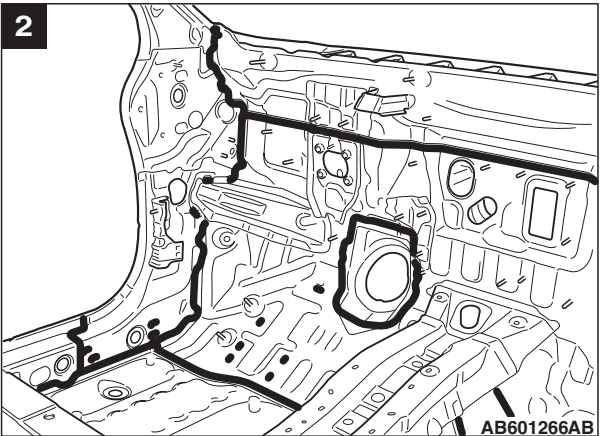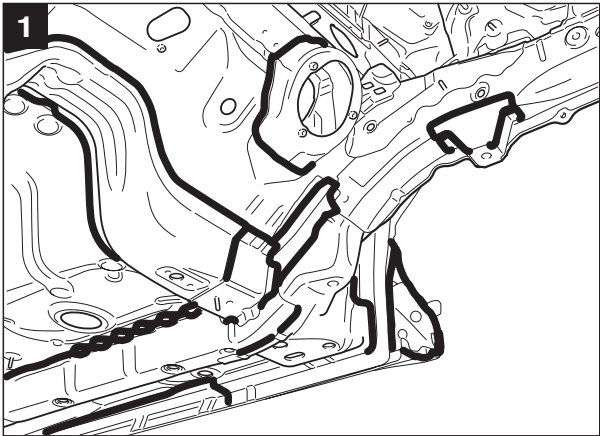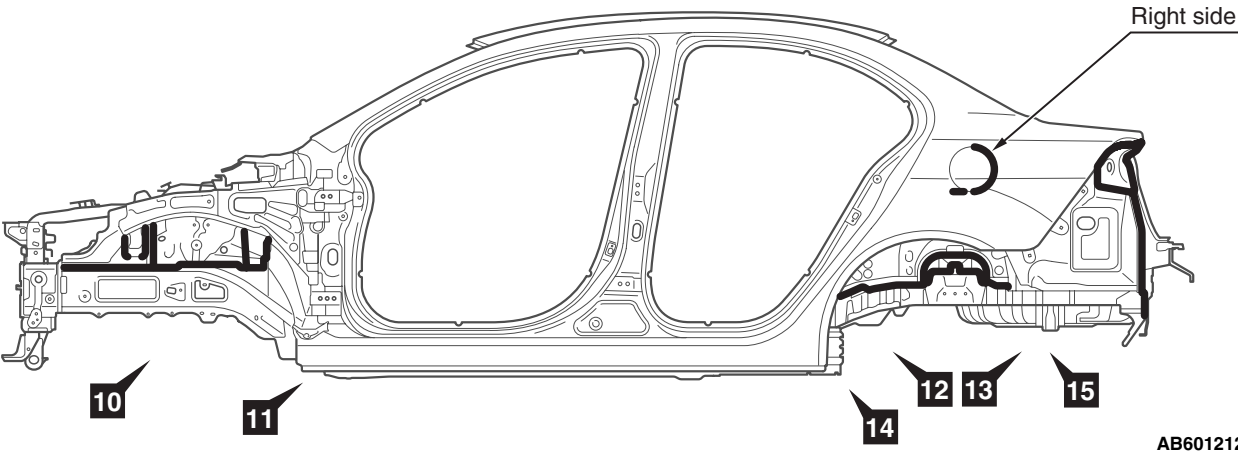

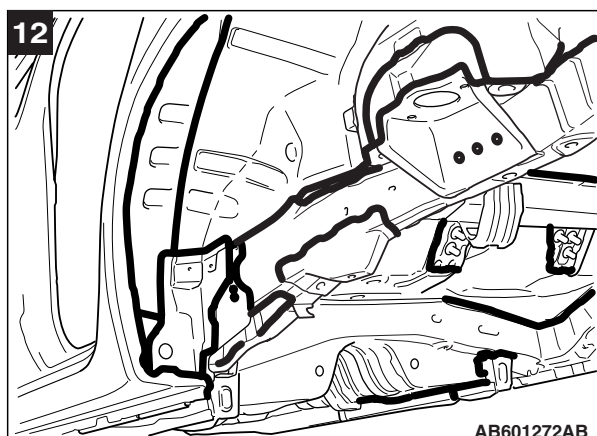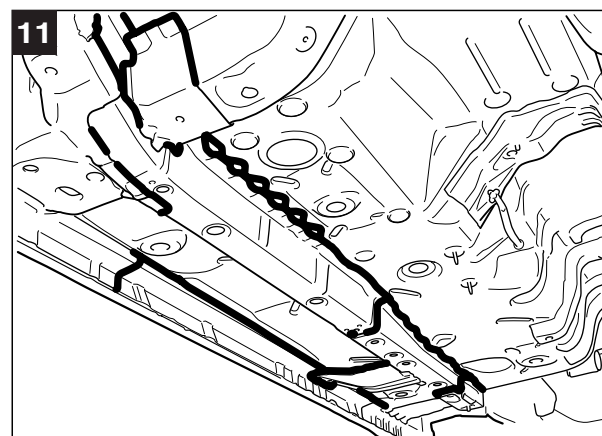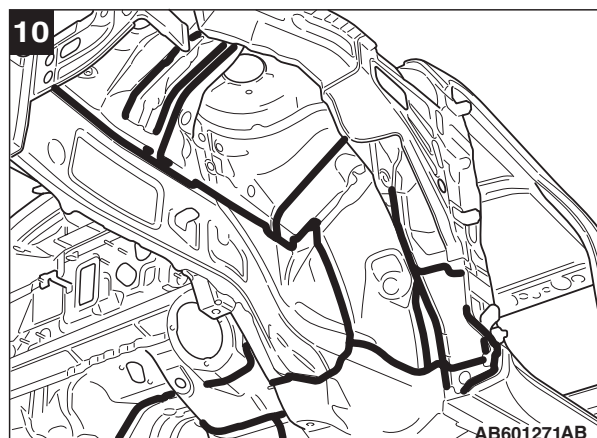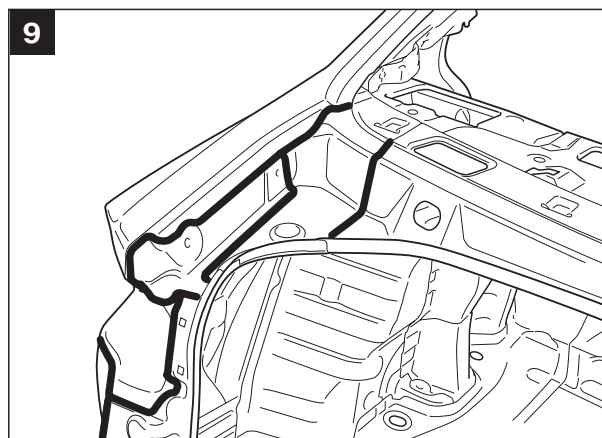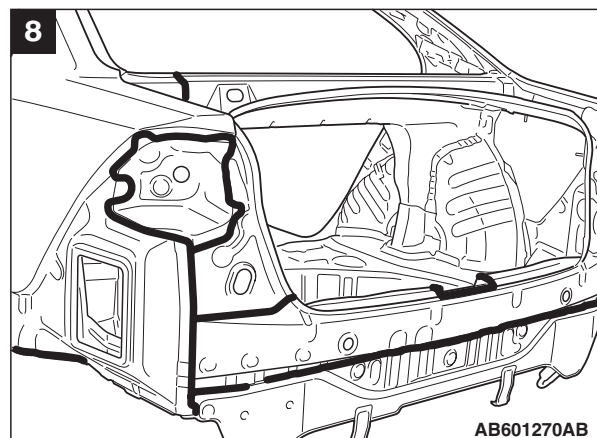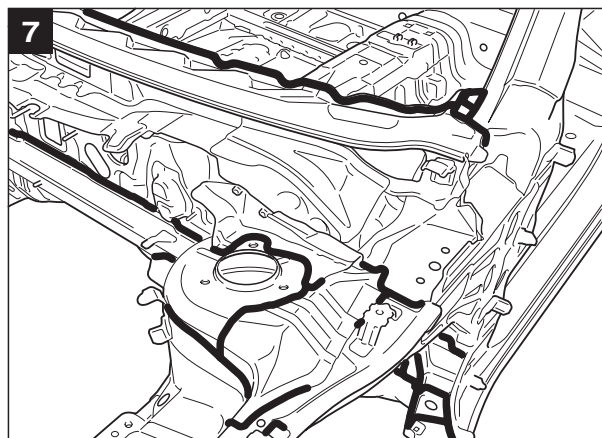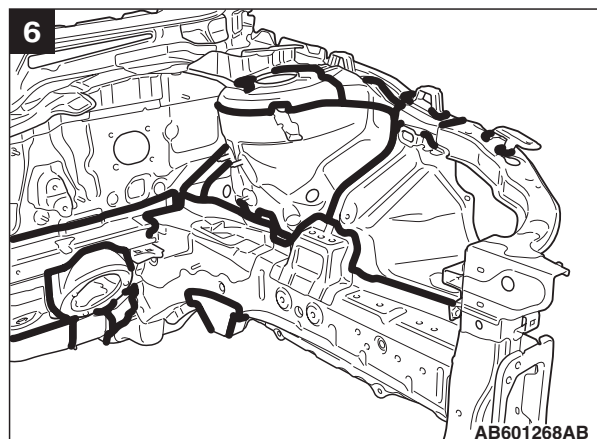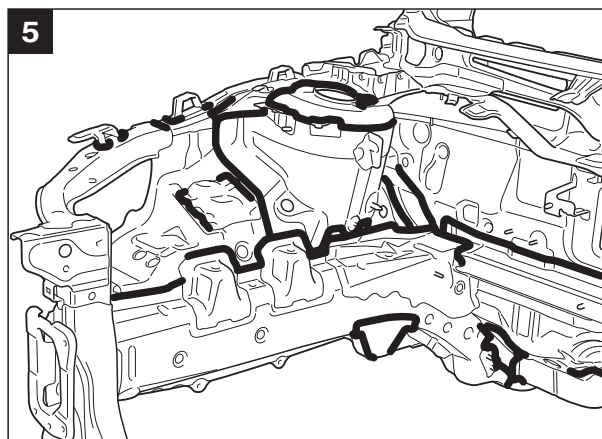

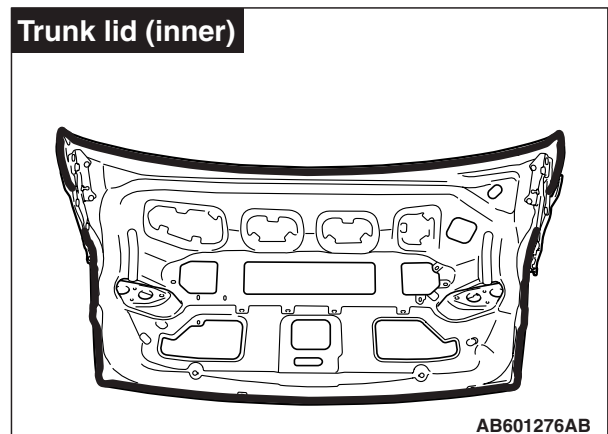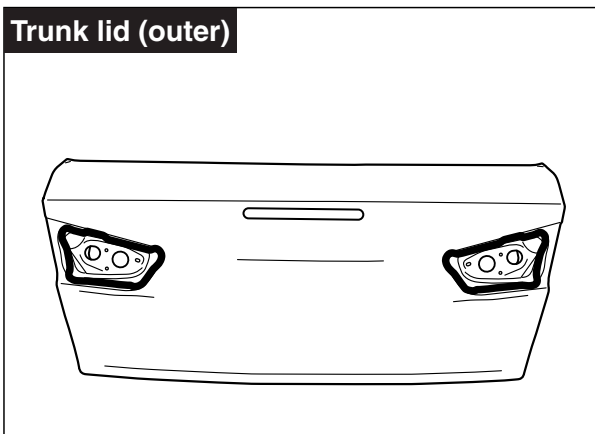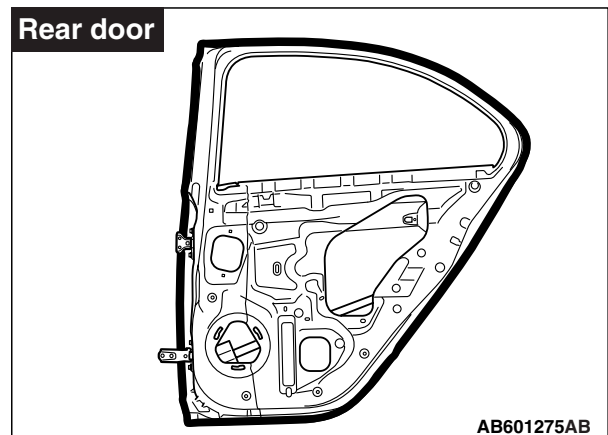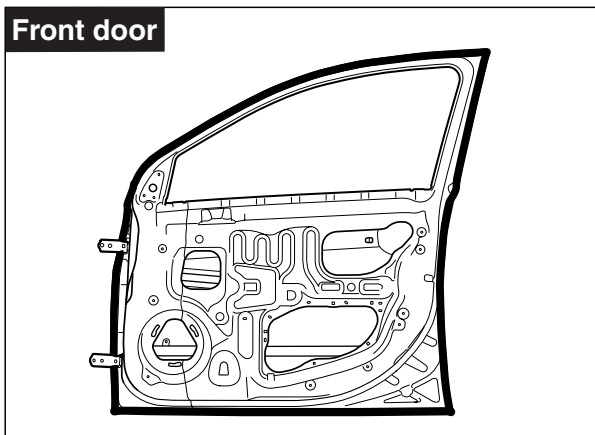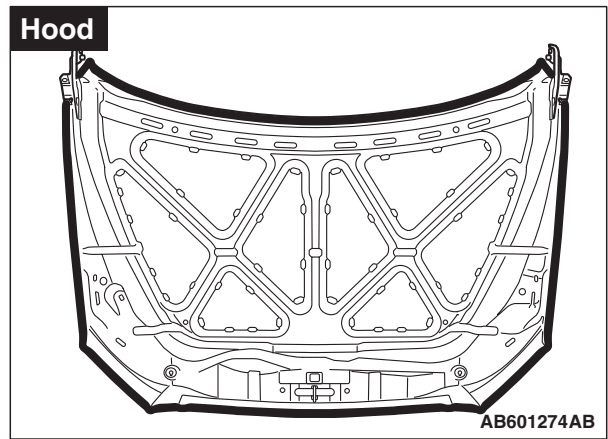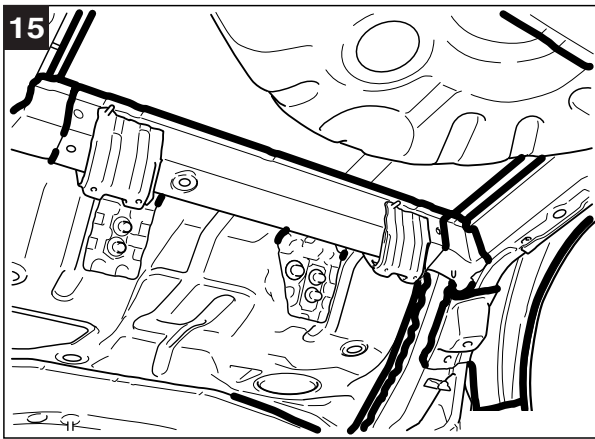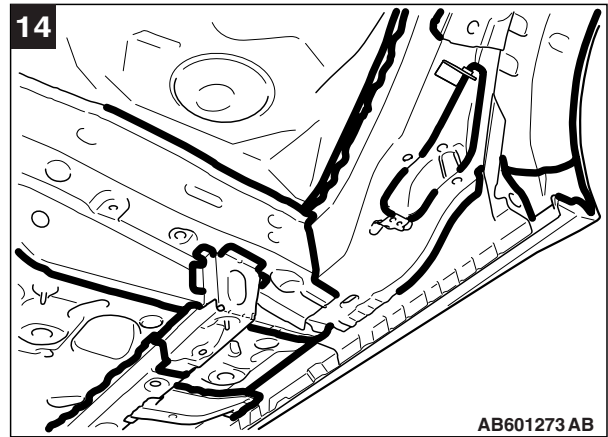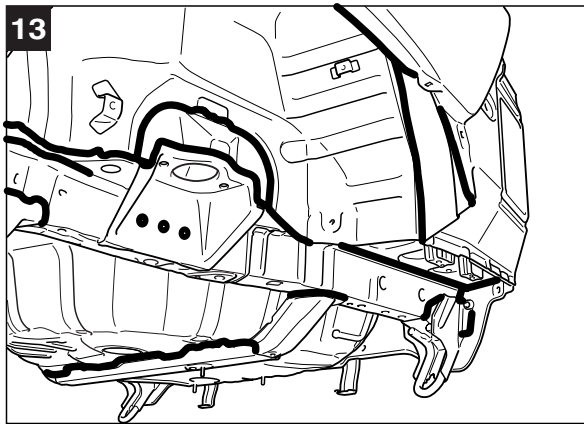

ANTICORROSION PRIMER LOCATIONS

M4040002000517

To prevent rusting from chipping (flying rock), an anti-corrosion primer has been applied to the areas indicated in the figure.


The primer is applied between the under and middle coat. It improves anti-corrosive performance by preventing flying rock to damage the body panel with the primer application, according to the thickness and elasticity of the primer. Apply the primer before the middle coat when replacing the panel complete with the primer application.

Primer : Rocker panel primer

Recommended primer:

**Glasurit FX89-7300 (Polyester basis) or
FX90-7103 (Water basis) or equivalent**

Coating thickness: 0.3 mm or more

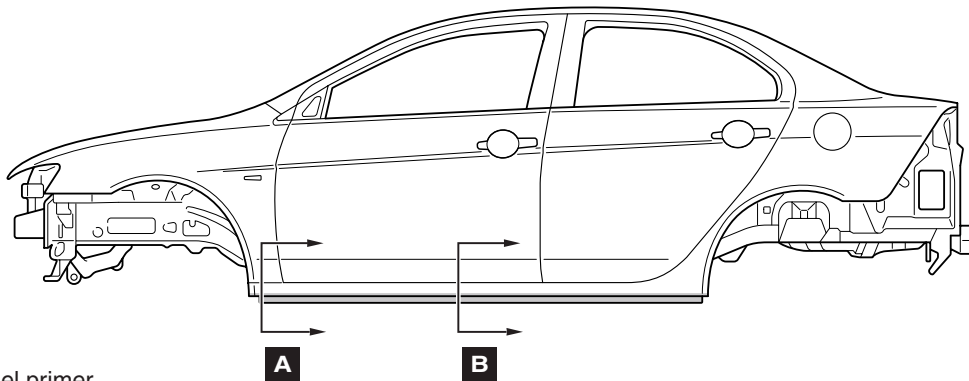

AB601539AB




AB601540AB

NOTE: Rocker panel primer is applied except for side air dam.

UNDERCOAT APPLICATION LOCATIONS

M4040003000684

- The under parts of the body is undercoated for anti-corrosive, anti-rust, anti-chipping, and anti-vibration performance.
- After correcting the body, restore as shown in the instructions of the figure, if necessary.
- Tape the areas marked with an asterisks to protect those areas from getting any undercoating on those areas.

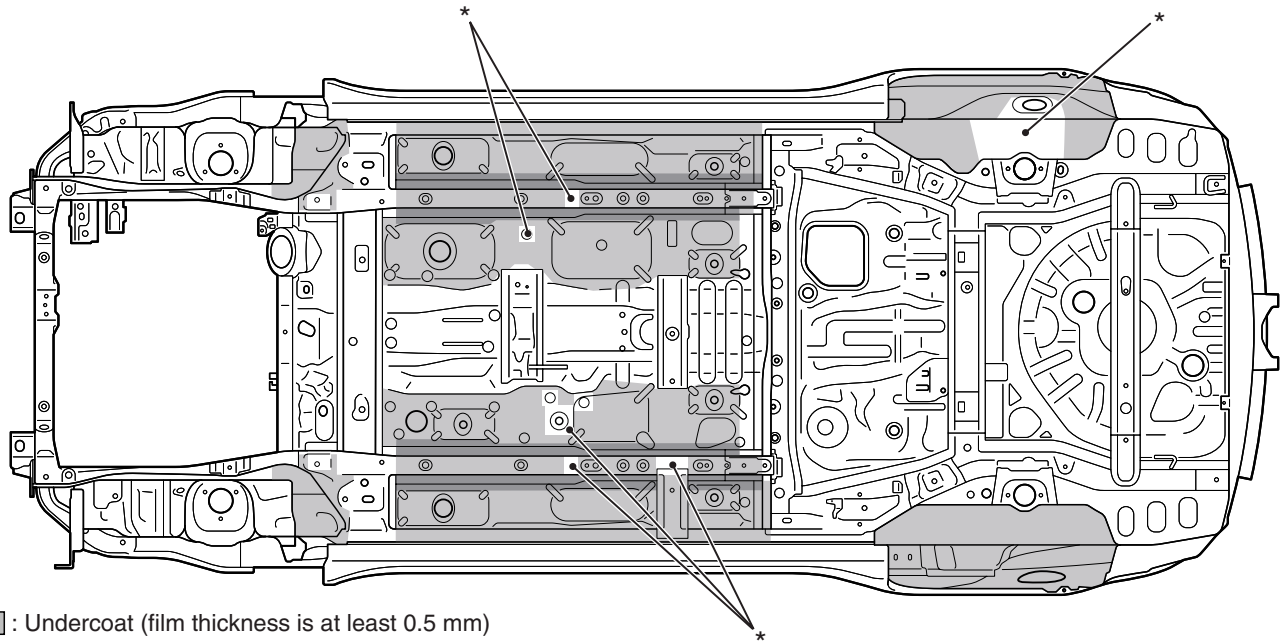

AB601154AB

NOTES